

Work Order ID 138495

Wednesday, October 28, 2015 12:59:07 PM

138495

Page 1

Item ID: D206-667-247TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Assembly, Mid Aft

Start Date: 10/28/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 10/28/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: MLSDate: OCT 28 2015

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D206-667-247

A

100

0.01

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.02

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DTxxxx on both ends as per Folio FB030

2-Turn first side as per Folio FB030

3-File down transition lines smooth.

FOLIO REV: AADWG REV: A

1 - ϕ - mm
16/02/17

110

QC1- Inspection performed by CMM

0.00

110

QC

Memo

0.00

Quality Control

QC2
5/6/2018

1 - ϕ - mm
16/02/18

Work Order ID 138495

Wednesday, October 28, 2015 12:59:07 PM

138495

Page 3

Item ID: D206-667-247TRN Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Crosstube Assembly, Mid Aft
Start Date: 10/28/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 10/28/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
145		0.00							
145									
Crosstubes	Memo	0.01							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.01							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								
160	QC7-Inspect Chemical Conversion Coat	0.00							
160									
QC	Memo	0.00							
Quality Control									

Tw 16-02-24

BL 16/02/29

1 2B
16-02-29

Work Order ID 138495

Wednesday, October 28, 2015 12:59:07 PM

138495

Page 4

Item ID: D206-667-247TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Assembly, Mid Aft

Start Date: 10/28/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 10/28/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170		0.00							
170	Packaging								
Packaging	Memo	0.00							
Packaging	LOCATION : LG014								
180									
	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.00							
Quality Control									

BC 16/02/29

MCS FEB 29 2016

MCS FEB 29 2016

Picklist Print

Wednesday, October 28, 2015 12:59:10 PM

Page 1

Work Order ID: 138495

138495

Parent Item: D206-667-247TRN

D206-667-247TRN

Parent Item Name: Crosstube Assembly, Mid Aft

Start Date: 10/28/2015

Required Date: 10/28/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP rev:A 11.01.06 new issue DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6004-115		Manufactured	No			100	Each	103.0000	1	1			

D6004-115

Crosstube Material

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
LG	14	
107870	14	
LG003	89	
107869	39	
116116	41	
75636	9	

1 mm L 16/02/17


DART AEROSPACE LTD		Work Order:	138495
Description: Crosstube Assembly, Mid Aft		Part Number:	D206-667-247
Inspection Dwg: D206-667-247 Rev: A		Page 1 of 2	

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.495	/		vern	CNC-08
	2.025	+0.005/-0.000	2.028	/			
	2.079	+0.005/-0.000	2.083	/			
	2.145	+0.005/-0.000	2.149	/			
	2.209	+0.005/-0.000	2.214	/			
	2.287	+0.005/-0.000	2.291	/			
	2.363	+0.005/-0.000	2.366	/			
	0.200	+/-0.010	.200	/		vern	CNC-08
	R0.063	+/-0.010	.063	/		RG	
	R2.00	+/-0.010	2.00	/		"	
	R0.063	+/-0.010	.063	/		"	
	4.438	+/-0.010	4.440	/		vern	CNC-08
SIDE B	2.490	+0.005/-0.000	2.494	/		vern	CNC-08
	2.025	+0.005/-0.000	2.028	/			
	2.079	+0.005/-0.000	2.083	/			
	2.145	+0.005/-0.000	2.149	/			
	2.209	+0.005/-0.000	2.214	/			
	2.287	+0.005/-0.000	2.290	/			
	2.363	+0.005/-0.000	2.366	/			
	0.200	+/-0.010	.200	/		vern	CNC-08
	R0.063	+/-0.010	.063	/		RG	
	R2.00	+/-0.010	2.00	/		"	
	R0.063	+/-0.010	.063	/		"	
	4.438	+/-0.010	4.440	/		vern	CNC-08
	99.76	+/-0.020	99.76	/		type	

DART AEROSPACE LTD		Work Order: 138495
Description: Crosstube Assembly, Mid Aft		Part Number: D206-667-247
Inspection Dwg: D206-667-247 Rev: A		Page 2 of 2

WALL THICKNESS MEASUREMENT

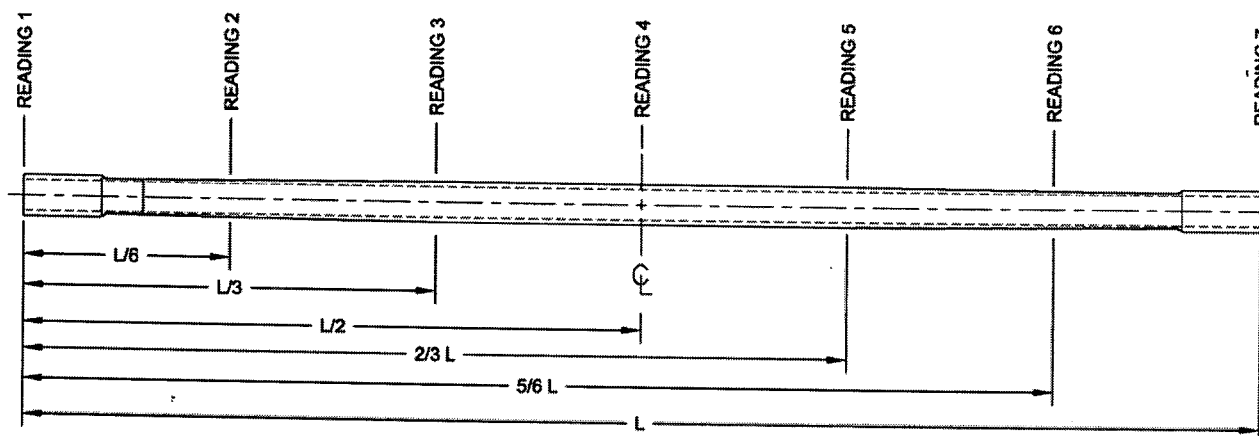

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.353	.358	.363	.352	.011	0.045"
READING 2 L= 17	.203	.195	.200	.201	.008	
READING 3 L= 33	.330	.331	.335	.335	.005	
READING 4 L= 50	.350	.354	.358	.354	.008	
READING 5 L= 67	.327	.335	.338	.328	.011	
READING 6 L= 83	.193	.197	.201	.190	.011	
READING 7 L= 99	.353	.358	.358	.346	.012	

Calibration Result

Actual Block Thickness: 100 - 250

DAS 47 Sitescan 250 Measured Thickness: 100 - 250

Measured by: <i>mgl</i>
Date: 16/02/18

Audited by: 9-89
Date: 16-02-24

Preliminary Approval:
Date:

Rev	Date	Change	Revised by	Approved
A	11.06.21	New Issue	KJ	
B	12.02.02	Dimension 4.438 was 4.500	KJ	
C	12.06.01	Wall thickness form added	KJ	

Item	Qty -247	Part Number	Description
1	X	D206-667-247	CROSSTUBE ASSEMBLY (206L MID AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-083-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6004-115
FINISHED LENGTH = 99.76±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-247" AND BATCH NUMBER ON INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS).
- 7) WEIGHT: 21.1 lbs (-607 = 17.7 lbs)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-22 CLAMPS WITH D3595-083-450 RUBBER CUSHIONS TO SECURE THE D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RELATION TO
INSTEAD OF
UNCO... COPY
SUBJECT...
WORK ORDER
NO. 138495 MLJ

157028

DEO ATTACHED

BCW #11-615

11.07.28

UNDER REVIEW

RELEASED
2011-05-24

A	NEW ISSUE	CP	10.12.23
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	10.12.23		


DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D206-667-247
TITLE CROSSTUBE ASSY (206L MID AFT)


REV. A
SHEET 1 OF 4
SCALE
NTS

COPYRIGHT © 2018 BY DART AEROSPACE LTD
THIS DOCUMENT IS PROVIDED AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.


8 7 6 5 4 3 2 1

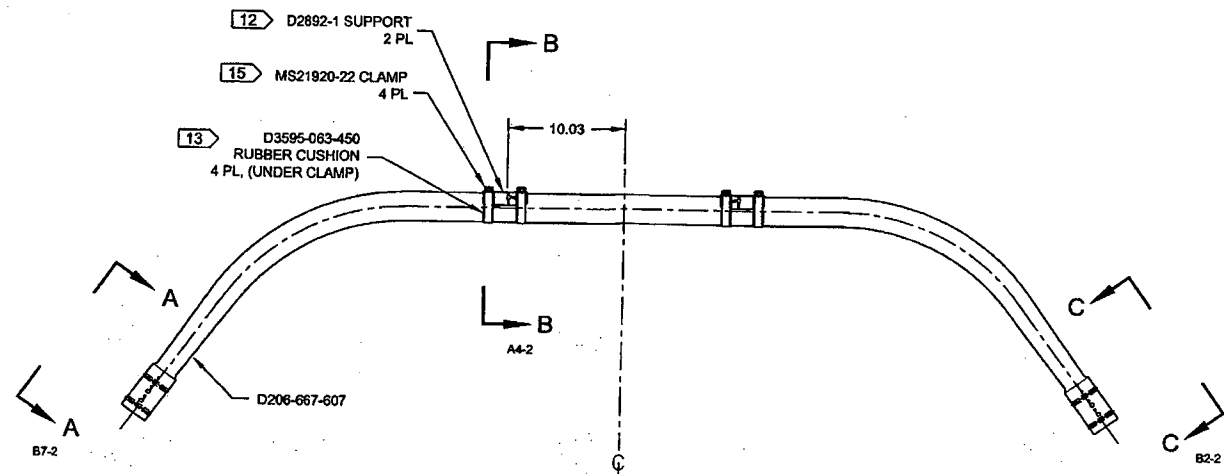


D206-667-247
ASSEMBLY DETAIL
(VIEW LOOKING FWD)

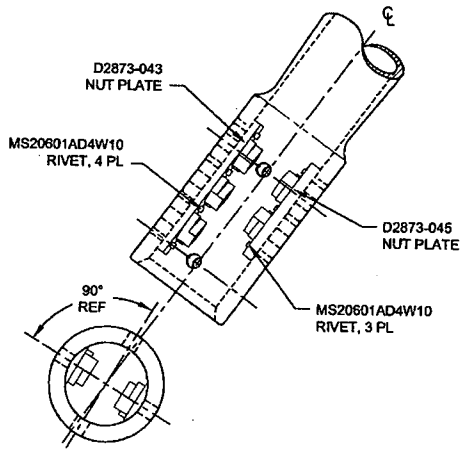

VIEW A-A:
CUFF DETAIL
SCALE 4X

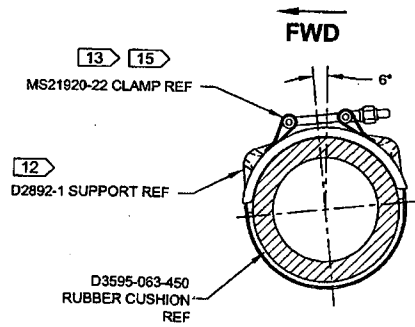

SECTION B-B
SCALE 5X

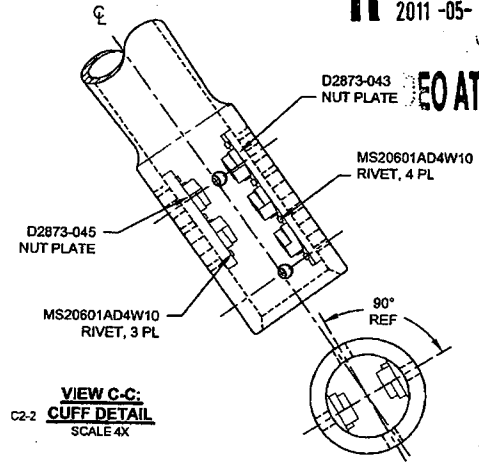


VIEW C-C:
CUFF DETAIL
SCALE 4X

SCW #11-615
11.07.26
UNDER REVIEW
12.6.13


RELEASED
2011-05-24
EO ATTACHED

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO. D206-667-247	REV. A
MFG. APPR.			SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L MID AFT)	NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

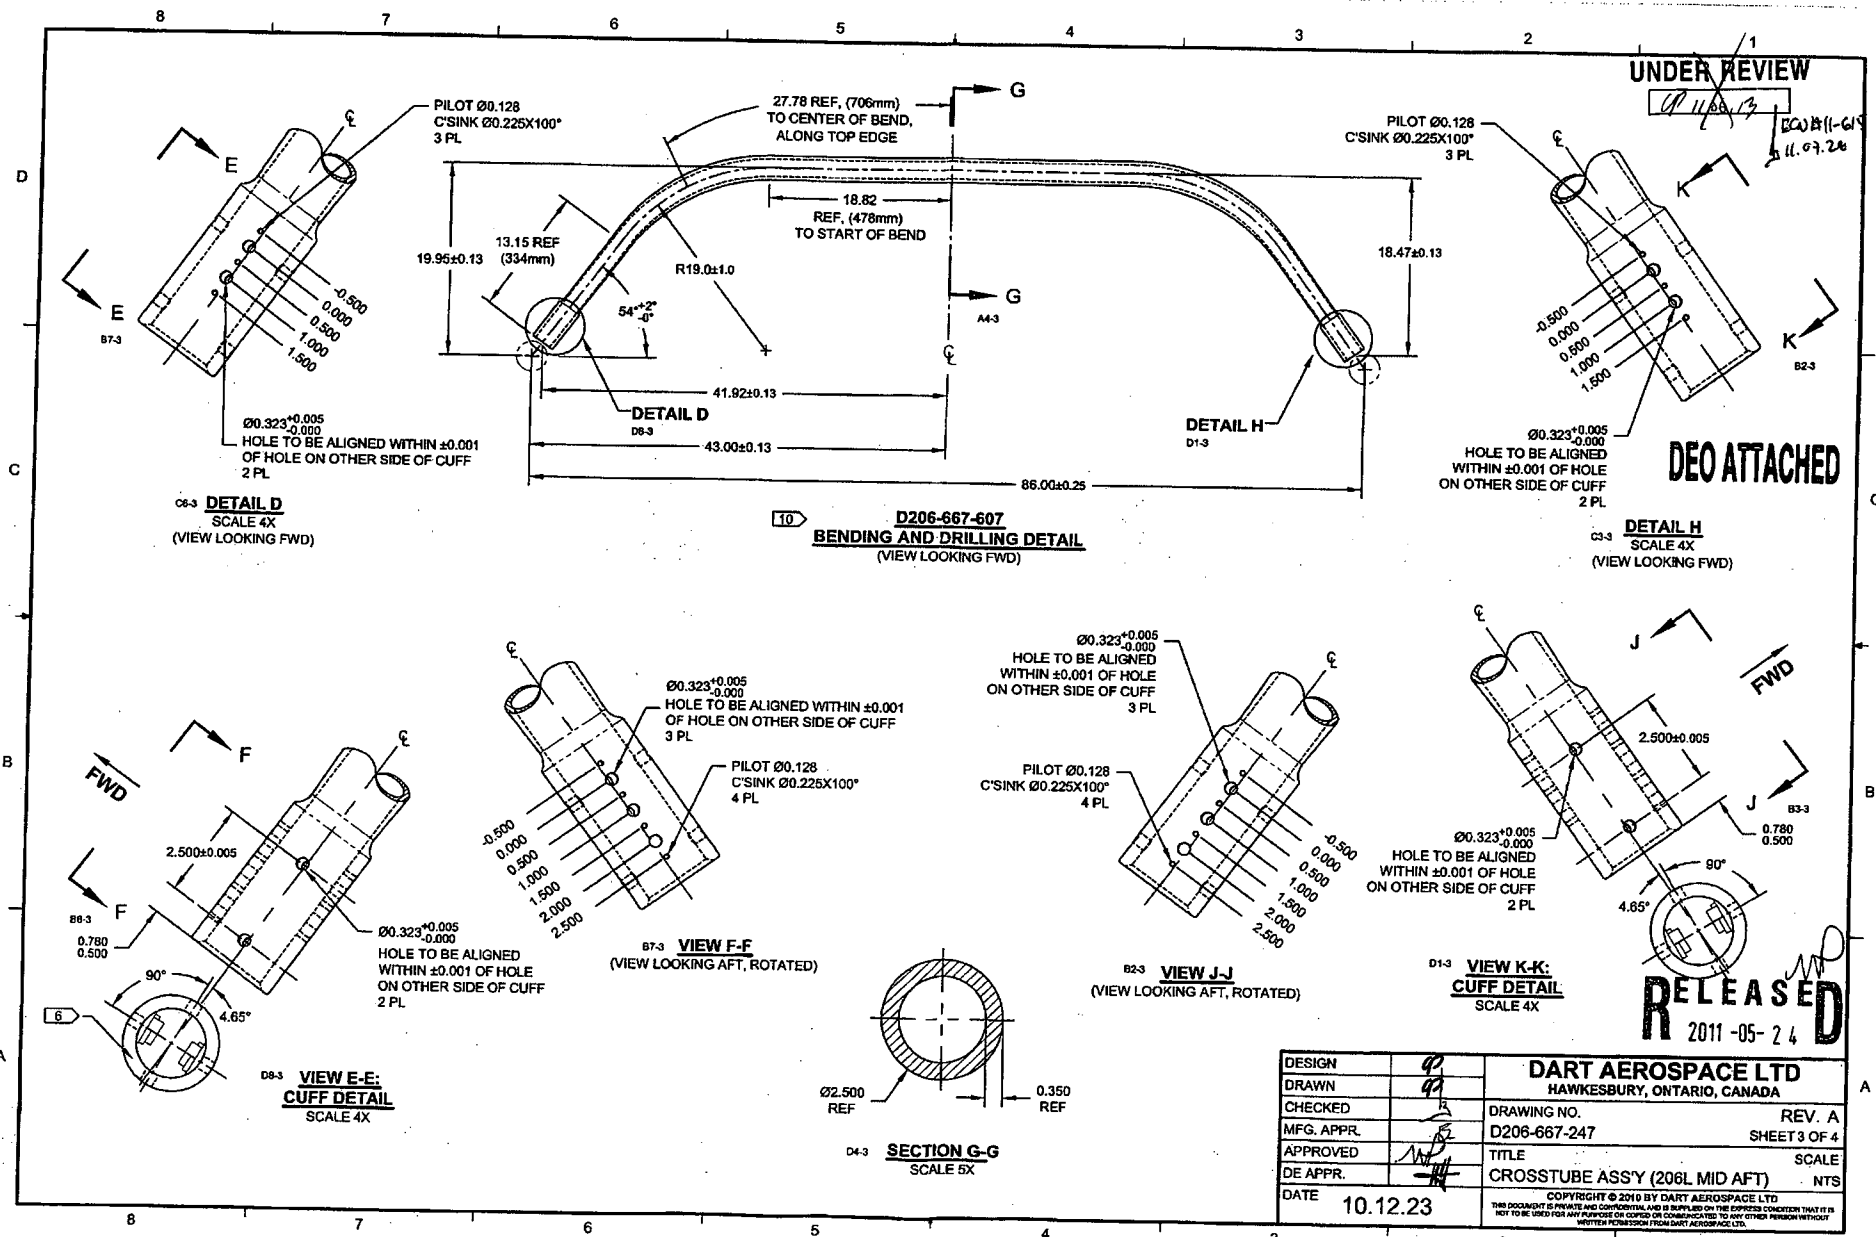


SEE DETAIL L
B7-4

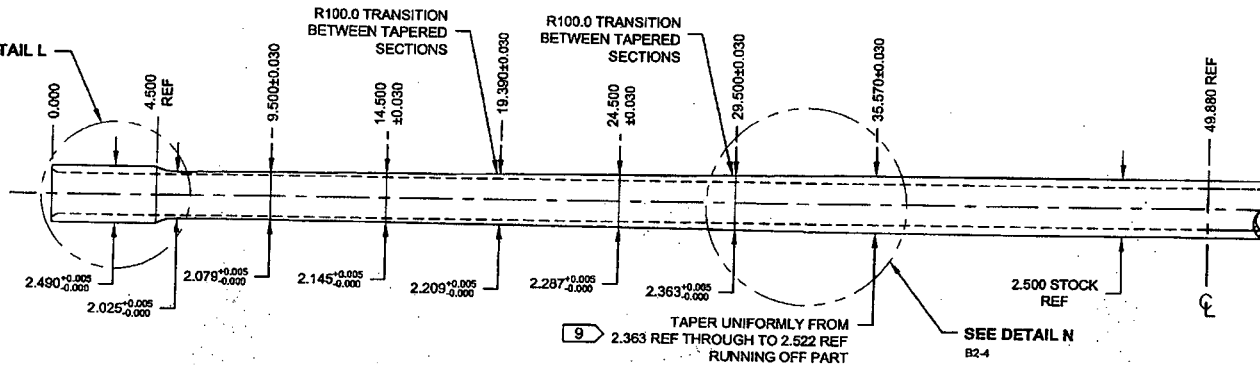


TURNING DETAIL

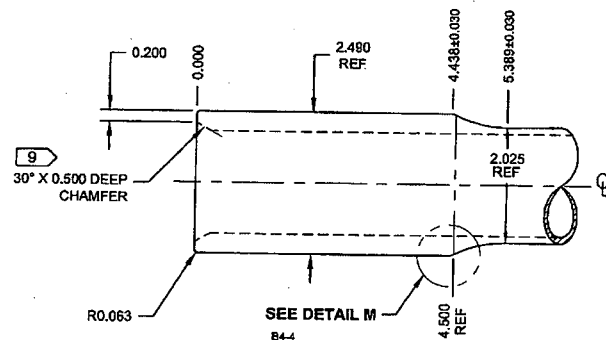

C7-4 **DETAIL L: CROSSTUBE CUFF**
SCALE 2.5X

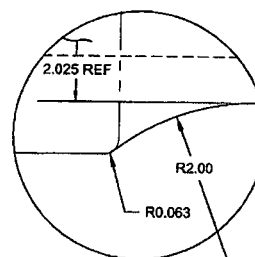

B6-4 **DETAIL M: CUFF TRANSITION**
NOT TO SCALE

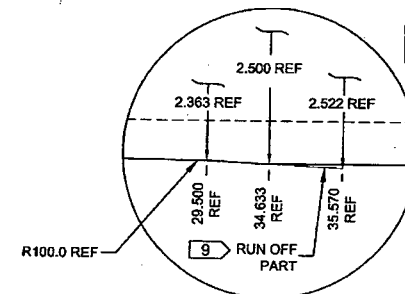

C4-4 **DETAIL N: TAPER RUN-OFF**
NOT TO SCALE

BCW #11-617
11.07.26
UNDER REVIEW
11.06.13

DEO ATTACHED

RELEASED
2011-05-24

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. A
MFG. APPR.		D206-667-247	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L MID AFT)	NTS
DATE	10.12.23	COPYRIGHT © 2010 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DRAWING NO. D206-667-247	TITLE CROSSTUBE ASS'Y (206L MID AFT)	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D206-667-247-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>qp</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>KB</i>	APPROVED <i>JMP</i>		DE APPR. <i>#</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -247	Part Number	Description
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2892-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
JMP